

Customer Display
DM-D110

Installation Manual / **設置マニュアル** / **安裝手冊**

CAUTIONS

- ❑ This document shall apply only to the product(s) identified herein.
- ❑ No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, without the prior written permission of Seiko Epson Corporation.
- ❑ The contents of this document are subject to change without notice. Please contact us for the latest information.
- ❑ While every precaution has been taken in the preparation of this document, Seiko Epson Corporation assumes no responsibility for errors or omissions.
- ❑ Neither is any liability assumed for damages resulting from the use of the information contained herein.
- ❑ Neither Seiko Epson Corporation nor its affiliates shall be liable to the purchaser of this product or third parties for damages, losses, costs, or expenses incurred by the purchaser or third parties as a result of: accident, misuse, or abuse of this product or unauthorized modifications, repairs, or alterations to this product, or (excluding the U.S.) failure to strictly comply with Seiko Epson Corporation's operating and maintenance instructions.
- ❑ Seiko Epson Corporation shall not be liable against any damages or problems arising from the use of any options or any consumable products other than those designated as Original EPSON Products or EPSON Approved Products by Seiko Epson Corporation.

TRADEMARKS

EPSON® is a registered trademark of Seiko Epson Corporation.
Microsoft®, MS®, MS-DOS®, Windows®, and Windows NT® are registered trademarks of Microsoft Corporation.

General Notice: Other product and company names used herein are for identification purposes only and may be trademarks of their respective companies.

Copyright © 2000 by SEIKO EPSON CORPORATION

Safety Precautions

This document presents important information intended to ensure safe and effective use of this product. Please read this document carefully, and store it in an accessible location near your installation.

Precaution Headings

This document uses the two headings shown below to call attention to potential hazards. Failure to observe the information provided under or alongside these headings may lead to injury or property damage. Be sure that you understand the meaning of each heading before you proceed.



WARNING:

Indicates a potentially lethal hazard. Failure to observe a WARNING may result in severe injury or death.



CAUTION:

Failure to observe a CAUTION may result in personal injury, or in damage to equipment or other property.

Safety Precautions



WARNING:

- ☐ Shut down your equipment immediately if it produces smoke, a strange odor, or unusual noise. Continued use may lead to fire or electric shock. Immediately turn the power off and contact your dealer or a SEIKO EPSON service center for advice.
- ☐ Never attempt to repair this product yourself. Improper repair work can be dangerous. Tampering with this product may result in injury, fire, or electric shock.
- ☐ Be sure to use the specified power source. Connection to an improper power source may cause fire or shock.
- ☐ Do not allow foreign matter to fall into the equipment. Penetration of foreign objects may lead to fire or shock.
- ☐ If water or other liquid spills into this equipment, immediately turn the power off and contact your dealer or a SEIKO EPSON service center for advice. Continued usage may lead to fire or shock.

CAUTION:

- ❑ *Do not plug the cable differently from the instruction in this manual. Wrong connection may cause equipment damage and fire.*
- ❑ *Be sure to set this equipment on a firm, stable, horizontal surface. Product may be damaged or cause injury if it falls.*
- ❑ *Do not use in locations subject to high humidity or dust levels. Excessive humidity and dust may cause equipment damage, fire, or shock.*
- ❑ *Do not place heavy objects on top of this product. Equipment may be damaged and cause injury if it falls.*
- ❑ *Do not attach more than one extension support. Product may be damaged or cause injury if it falls.*
- ❑ *A stopper limits the horizontal rotation of the display. Do not try to force it to turn beyond the limits of the stopper. Doing so may damage the equipment.*
- ❑ *If the DM-D110 is used with the TM-H5200, be sure to attach a ferrite core to meet the EMC standards. It is prohibited legally to import and sell products that do not meet the EMC standards in countries where the standards are applied. Using the products that do not meet the EMC standards may cause radio interference to other electronic equipments.*

EMC and Safety Standards Applied

Product Name: DM-D110

Type Name: M58DB

The following standards are applied only to the display that is so labeled. (EMC is tested using the EPSON PS-170 power supply.)

- | | |
|------------------|---|
| ❑ Europe: | CE Marking
Safety: EN60950 |
| ❑ North America: | EMI: FCC/ICES-003 Class A
Safety: UL 1950/CSA C22.2 No.950 |
| ❑ Japan: | EMC: VCCI Class A JEIDA-52 |
| ❑ Oceania: | EMC: AS/NZS 3548 (CISPR22) Class B |

CE Marking

The display conforms to the following Directives and Norms

Directive 89/336/EEC

EN55022 Class B

EN55024

IEC 61000-4-2

IEC 61000-4-3

IEC 61000-4-4

IEC 61000-4-5

IEC 61000-4-6

IEC 61000-4-11

WARNING

You are cautioned that changes or modifications not expressly approved by SEIKO EPSON Corporation could void your authority to operate the equipment.

FCC COMPLIANCE STATEMENT FOR AMERICAN USERS

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment.

This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

FOR CANADIAN USERS

This Class A digital apparatus complies with Canadian ICES-003.

Cet appareil numérique de la classe A est conforme à la norme NMB-003 du Canada.

About This Manual

Cautions and Notes



CAUTION:

Cautions must be observed to avoid minor injury to yourself or damage to your equipment.



Note:

Notes have important information and useful tips on the operation of your display.


Contents

About This Manual	3
Contents	4
Unpacking	5
Cautions on Handling	5
Usage	6
Assembling	7
Attaching to the IM series	7
Attaching to the TM-H5000II/TM-J8000	9
Attaching to the TM-U375/TM-U950	12
Attaching to the TM-H6000/TM-U675	15
Attaching to Other TM Printers	21
Attaching to the DM-D stand	24
Part Names and Functions	32
Exterior	32
DIP Switch	33
DIP Switch Functions	33
Turning and Tilting the DM-D110	35
Self Test	36
Check Items of Self test	36
Performing Self test	36
Diagnostics	36
Specification	37
General Specifications	37
Electrical Specifications	39
Environmental Specifications	39
Character Specifications	40
Reliability Specification	40

This manual explains how to set up the DM-D110.

Unpacking

The following items are in the box.

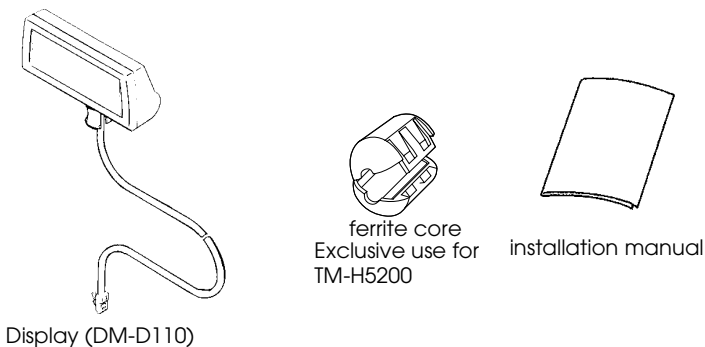

Make sure that you have all the items shown above, and that none has been damaged. If you find anything missing or damaged items, please contact your DM-D110 dealer.

Cautions on Handling

When you use the DM-D110, be sure to note the following points:

- ☐ Avoid locations that are subject to high temperature and humidity.
- ☐ Avoid dirty and dusty locations.
- ☐ Avoid locations that are unstable or are subject to high levels of vibration.
- ☐ When connecting or disconnecting cables, make sure that the power switch of the DM-D110 and printers connected to the DM-D110 are turned off.
- ☐ Do not drop the DM-D110 because you may damage the built-in vacuum fluorescent display.
- ☐ Attach the ferrite core before connecting to a printer.

Usage

The DM-D110 can be used with the following equipment.

- ❑ **IM series.** You can attach the DM-D110 to the IM series using the “DM-D pole unit for IR” (DP-504). (See page 7.)
- ❑ **TM-H5000II/TM-J8000 printers.** You can attach the DM-D110 to TM-H5000II/TM-J8000 printers using the “DM-D pole unit for TM printers (Type B)” (DP-503). (See page 9.)
- ❑ **TM-U375/TM-U950.** You can attach the DM-D110 to the TM-U375/TM-U950 printers using the “DM-D pole unit for TM printers (Type A)” (DP-502). (See page 13.)
- ❑ **TM-H6000/TM-U675.** You can attach the DM-D110 to TM-H6000/TM-U675 printers using the “DM-D pole unit for TM printers (Type A)” (DP-502). (See page 16.)
- ❑ **Other TM printers.** You can attach the DM-D110 using the “DM-D pole unit for TM printers (Type A)” (DP-502) and Velcro tapes or screws. (See page 21.)
- ❑ **DM-D stand.** You can attach the DM-D110 to the DM-D stand directly using the “DM-D stand unit for DM Customer Display” (DP-110). When using the DM-D stand, an optional power supply unit (PS-170) is required. Also, if you want to extend the height of the DM-D110, an optional extension support unit (DP-105) is required. (See page 24.)


Assembling

Attaching to the IM series

The DM-D110 can be attached directly to the IM series using the “DM-D pole unit for IR” (DP-504).

Required items


The following items are used to attach the DM-D110 to the IM series. These items are packed with the “DM-D pole unit for IR” (DP-504).




base



fixing screws

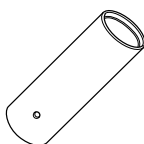


support A

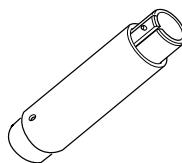

support B
(for extension)

Assembling steps

1. Pass the cable for the DM-D110 through support A, and attach support A to the DM-D110.
When using support B for extension, insert the tab on support B into the hole on support A until you feel it click.

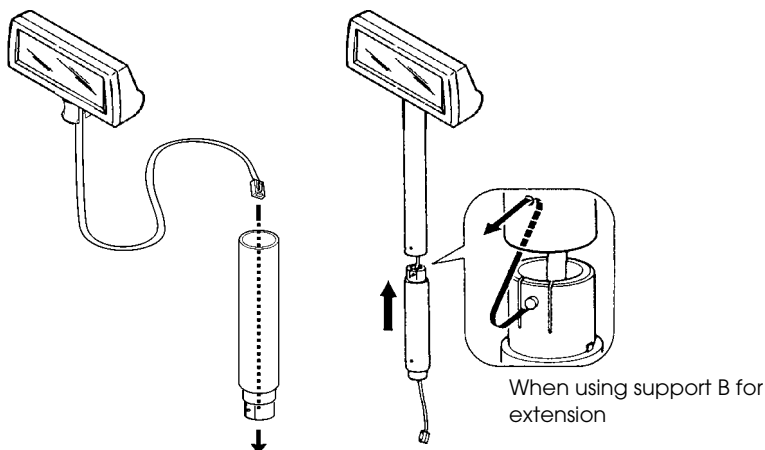


2. Attach the base to the setting position on the IM series and secure it with the screws.




Note:


When attaching the base, note that the corners of the base are set as shown below.

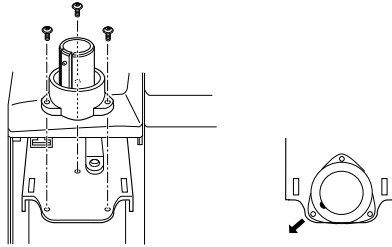


3. Pass the cable for the DM-D110 through the base.

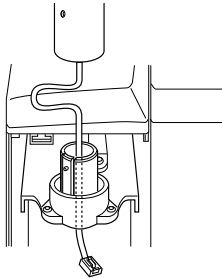

4. Insert the tab on the base into the hole on the support until you feel it click.

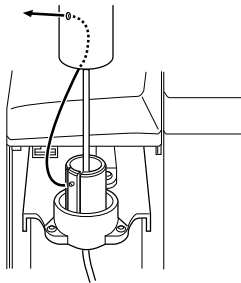

5. Connect the cable for the DM-D110 to the DM connector on the IM series.

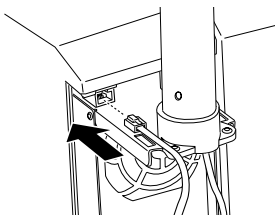

CAUTION:

Arrange the cable so that it does not touch the FAN below. When the cable touches the FAN, it may cause abnormal sounds or break the cable.


The place of the DM connector depends on the model of IM series.

Attaching to the TM-H5000II/TM-J8000


The DM-D110 can be attached directly to the TM-H5000II/TM-J8000 printers using the “DM-D pole unit for TM printers (Type B)” (DP-503).

Required items

The following items are used to attach the DM-D110 to the TM-H5000II /TM-J8000 printers. These items are packed with the “DM-D pole unit for TM printers (Type B)” (DP-503).




base

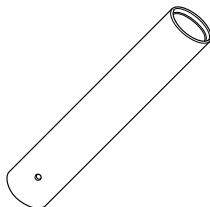

support C




fixing screws

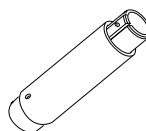


support B
(for extension)

Assembling steps


1. Pass the cable for the DM-D110 through support C and attach support C to the DM-D110.
When using support B for extension, insert the tab on support B into the hole on support C until you feel it click.

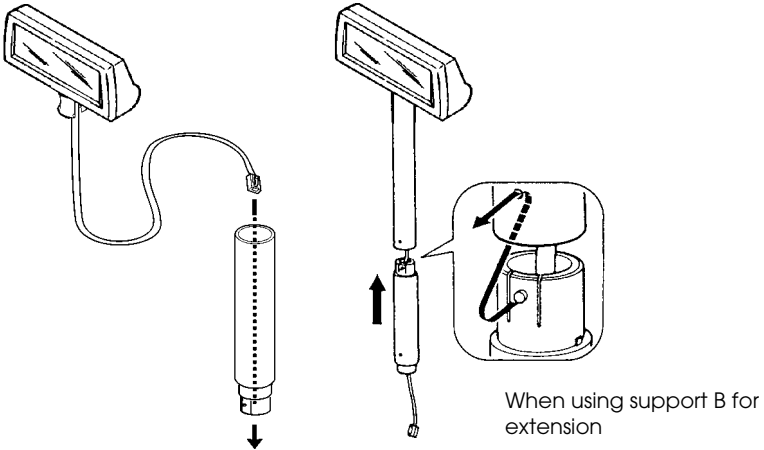


2. Attach the base to the setting position on the TM printer and secure it with the screws.

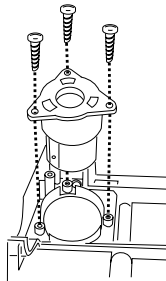


3. Pass the cable for the DM-D110 through the base.

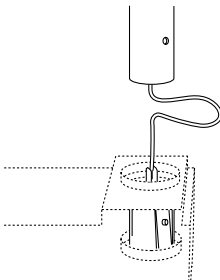


4. Insert the tab on the base into the hole on the support until you feel it click.

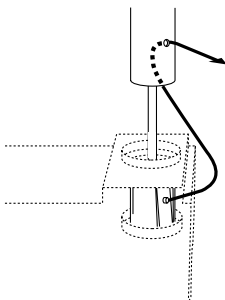

5. When connecting to the TM-H5200, attach the ferrite core, which is packed with the DM-D110, to the part near the connector of the DM-D110 connecting cable. When connecting to other products, you do not need to attach the ferrite core.

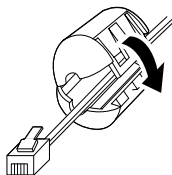

6. Connect the cable for the DM-D110 to the DM connector on the TM printer.

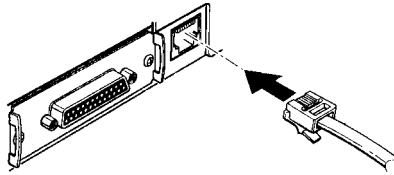


Attaching to the TM-U375/TM-U950

The DM-D110 can be attached directly to the TM-U375/TM-U950 printers using the “DM-D pole unit for TM printers (Type A)” (DP-502).


Required items

The following items are used to attach the DM-D110 to the TM-U375/TM-U950 printers. These items are packed with the “DM-D pole unit for TM printers (Type A)” (DP-502).

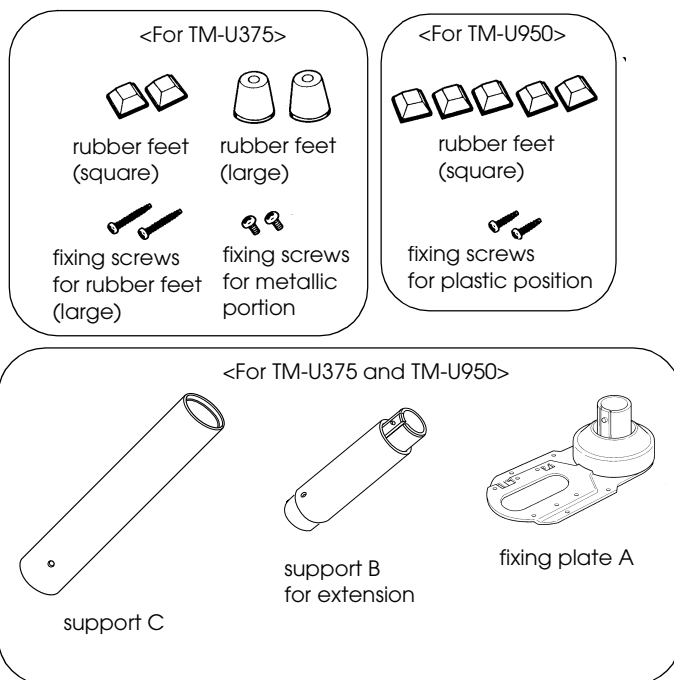


Assembling steps


1. Pass the cable for the DM-D110 through support C and attach support C to the DM-D110.
When using support B for extension, insert the tab on support B into the hole on support C until you feel it click.

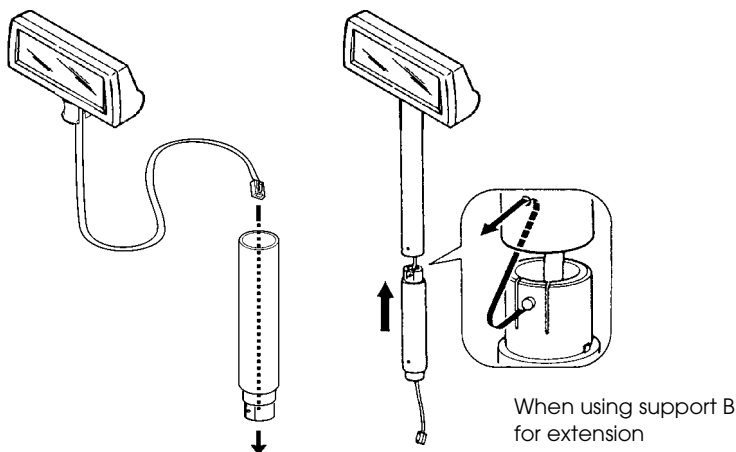

2. Attach the rubber feet to the printer.

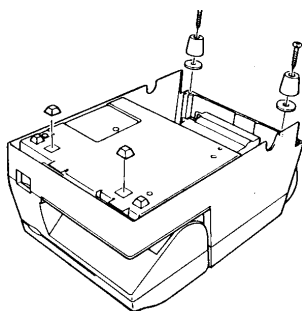


(TM-U375)

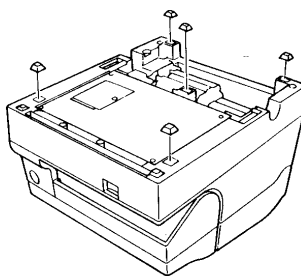


(TM-U950)


3. Pass the cable for the DM-D110 through the hole on fixing plate A and fix the cable at the bottom as shown below.

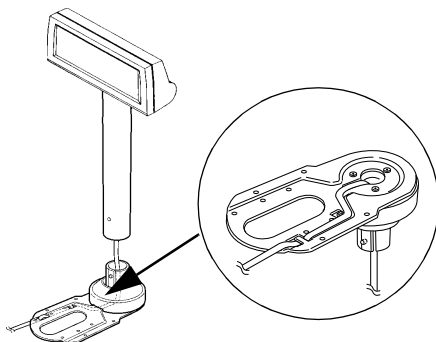


4. Connect the cable for the DM-D110 to the DM connector on the TM printer.

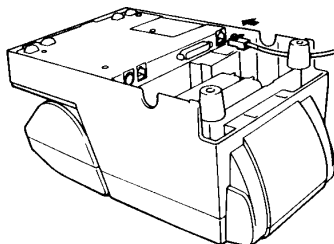

5. Adjust the length of the cable and secure fixing plate A to the printer with screws.

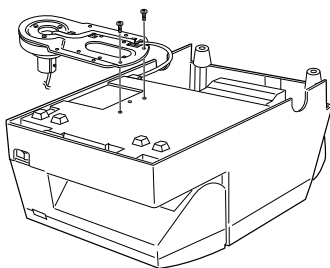


(TM-U375)

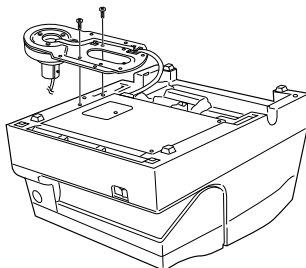

(TM-U950)

6. Store any excess cable in the support, and attach the DM-D110 to fixing plate A.

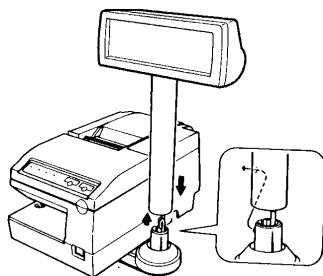

Attaching to the TM-H6000/TM-U675

The DM-D110 can be attached directly to the TM-H6000/TM-U675 printers using the “DM-D pole unit for TM printers (Type A)” (DP-502). You can attach fixing plate A on either side of the TM-H6000/TM-U675. After attaching it, you can slide the display freely.

Required items

The following items are used to attach the DM-D110 to the TM-H6000/TM-U675 printers. These items are packed with the “DM-D pole unit for TM printers (Type A)” (DP-502).




stopper



fixing screw
for stopper



angle fixing
screw

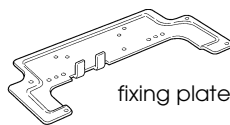

fixing plate B




fixing screws for
rubber feet (small)




rubber feet (small)




fixing screws for
fixing plate B

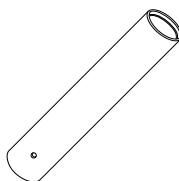

support C




support B
for extension

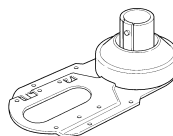


fixing plate A

Assembling steps


1. Pass the cable for the DM-D110 through support C, and attach support C to the DM-D110.
When using support B for extension, insert the tab on support B into the hole on support C until you feel it click.

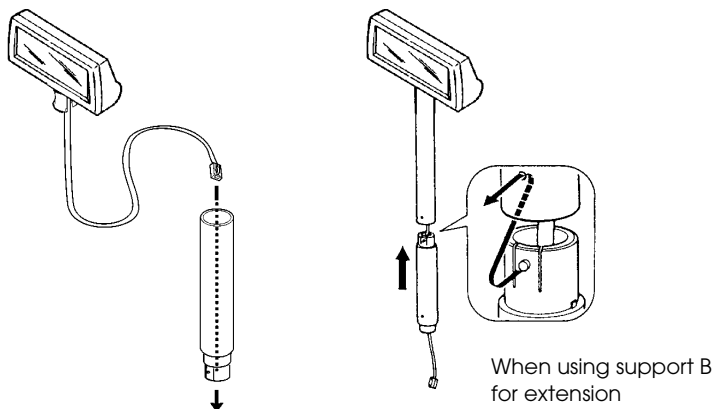


2. Attach the rubber feet to the printer.

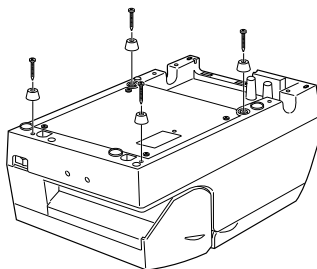


3. Attach fixing plate B to the printer.

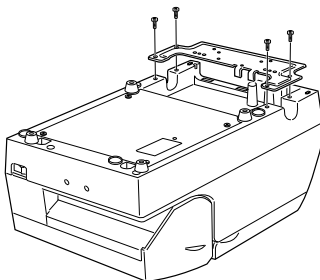


4. Pass the cable for the DM-D110 through the hole on fixing plate A, and fix the cable at the bottom as shown below.

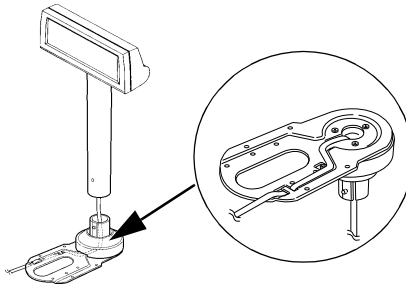









5. Connect the cable for the DM-D110 to the DM connector on the TM printer.

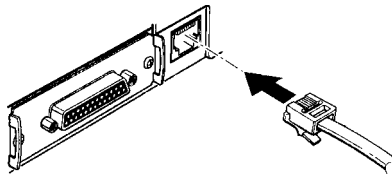

6. Attach fixing plate A to the TM printer using the stopper. When you attach the stopper, insert the projections on the stopper into the holes of fixing plate B. Fixing plate A can be attached on either side of the printer. (The illustration below shows fixing plate A attached to the right side of the printer.)

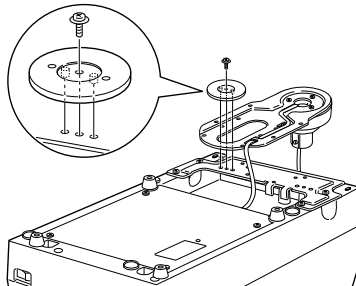


7. The horizontal rotation mechanism of fixing plate A can be adjusted. To secure the location of the display, set fixing plate A to either one of the following four positions and secure it with the angle fixing screw.

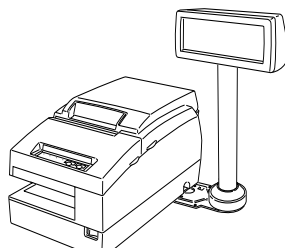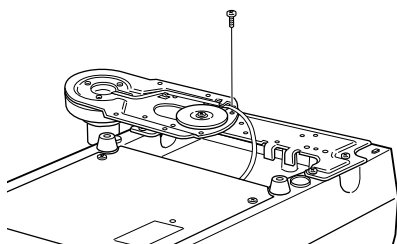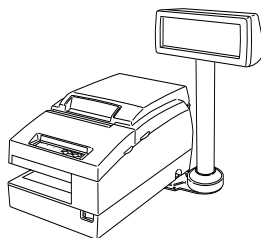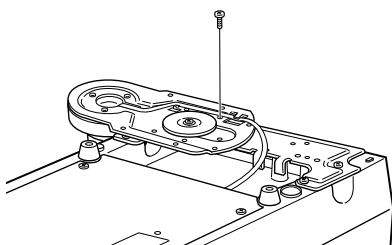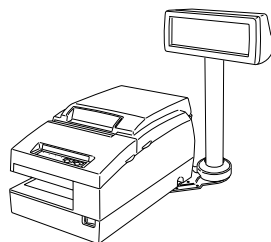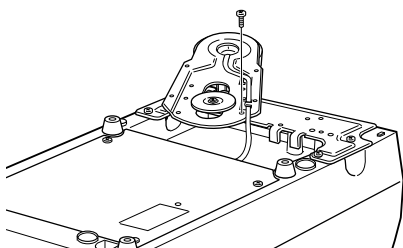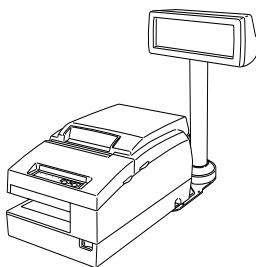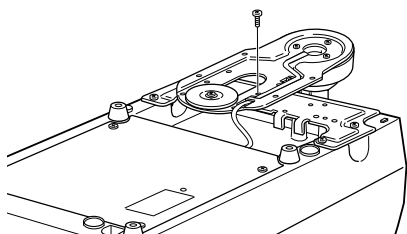




Note:


The paper roll cover may not open if the position of the display is inappropriate. Before securing the position of the display, make sure that you can open the paper roll cover.

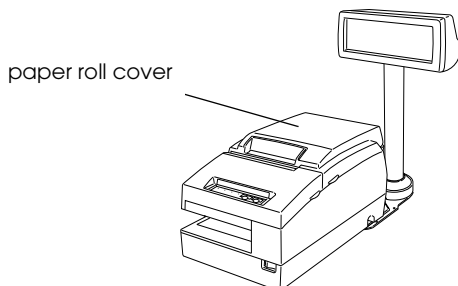

8. Store any excess cable in the support and attach the DM-D110 to fixing plate A.

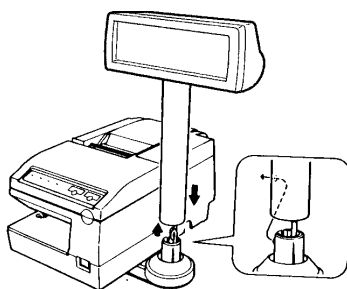

9. Connect the power cable of the printer. To avoid disconnection, hook the cable to the tabs on fixing plate B, as shown below.

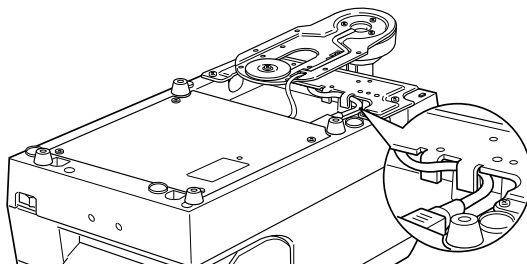


Attaching to Other TM Printers


When using with other TM printers, the DM-D110 can be attached to a desk or other surface, using the “DM-D pole unit for TM printers (Type A)” (DP-502), and Velcro tapes or screws.

Required items

The following items are used when the DM-D110 is used with other TM printers. These items are packed with the “DM-D pole unit for TM printers (Type A)” (DP-502).

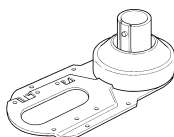

fixing plate A




Velcro tapes




Velcro tapes



fixing screws for
wood position

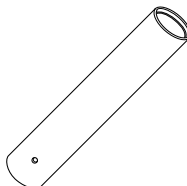


support C

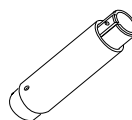


support B (for extension)

Assembling steps using Velcro tapes


1. Attach Velcro tapes to the bottom of fixing plate A.

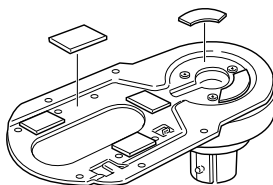


2. Pass the cable for the DM-D110 through support C and attach support C to the DM-D110.
When using support B for extension, insert the tab on support B into the hole on support C until you feel it click.

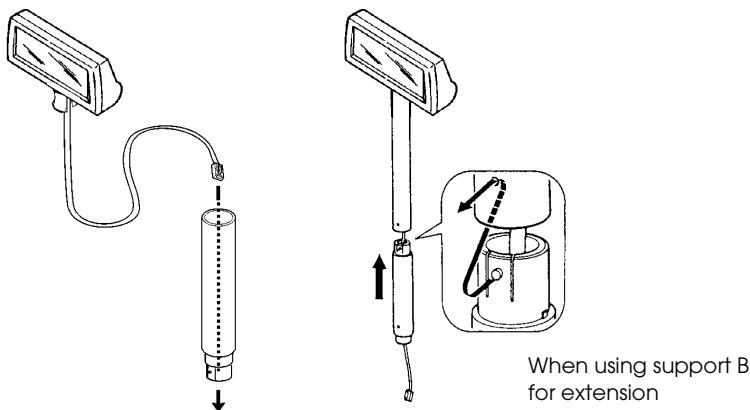


3. Pass the cable for the DM-D110 through the hole on fixing plate A, and fix the cable at the bottom as shown below.

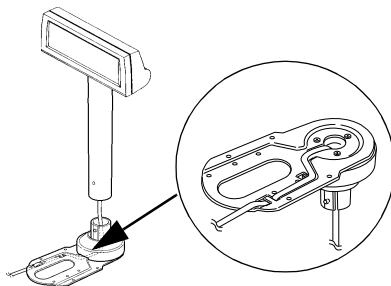

4. Connect the cable for the DM-D110 to the DC connector on the TM printer.

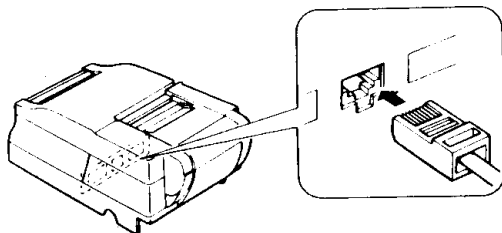


5. Store any excess cable in the support, and attach the DM-D110 to fixing plate A.

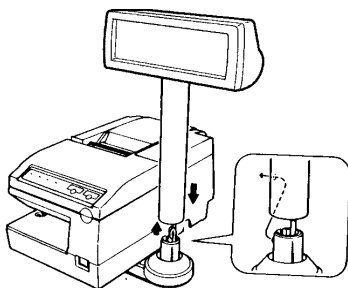

6. Peel off the Velcro tapes and attach the display to the setting position.

Assembling steps using screws

1. Follow steps 2 and 3 in “Assembling steps using Velcro tapes.”
2. Secure fixing plate A to the setting position with fixing screws.

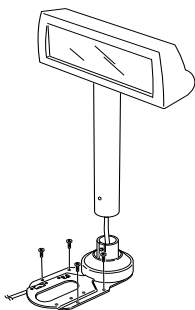




3. Attach the DM-D110 to fixing plate A.

Attaching to the DM-D stand

The DM-D110 can be attached directly to the DM-D stand using the “DM-D stand unit for DM Customer Display” (DP-110). The DM-D110 with the DM-D stand can be connected to a TM printer, or be used as a standalone product.


Required items

The following items are used to attach the DM-D110 to the DM-D stand. Note that an optional power unit (PS-170) is required when using the DM-D stand. If you want to extend the length of the DM-D110. You must get the items separately from the DM-D stand unit (DP-501).

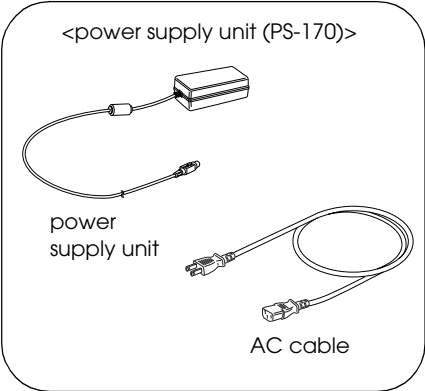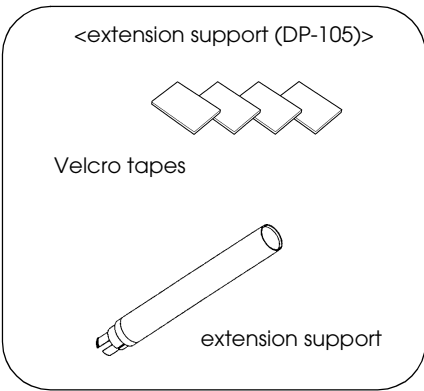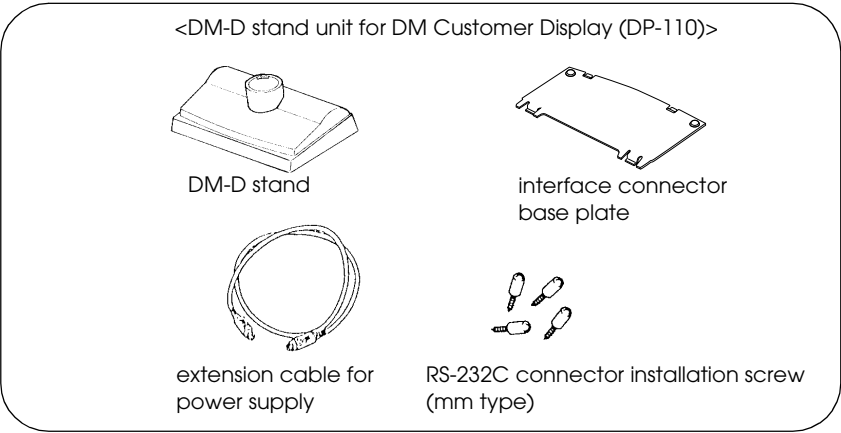

Connectors for the DM-D stand


The connectors for the DM-D stand are as follows:

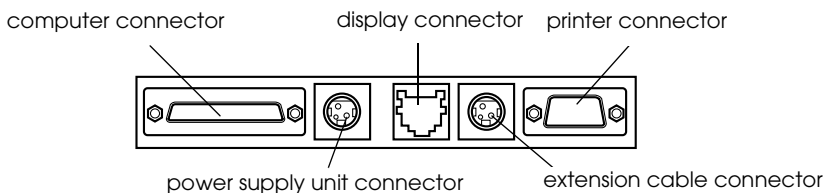


Note:

The DM-D stand comes with inch-type hexagonal lock screws installed to secure the interface cable to the interface connector for RS-232. If you plan to use an interface cable which requires millimeter-type lock screws, replace the inch-type screws with the included millimeter-type screws using a hex screwdriver (5mm). To distinguish the two types of screws, see the illustration below.


notch (one or more lines)



inch-type



millimeter-type




RS-232C connector
installation screw

Jumper setting

Set the jumpers on the DM-D stand as follows:

JP1	JP2	Perpose
1-2	1-2	For connecting both the TM printer and the DM-D stand. (Default setting)
2-3	2-3	For using the DM-D stand a standalone. (TM printer is not connected.)

The jumpers are located as follows:

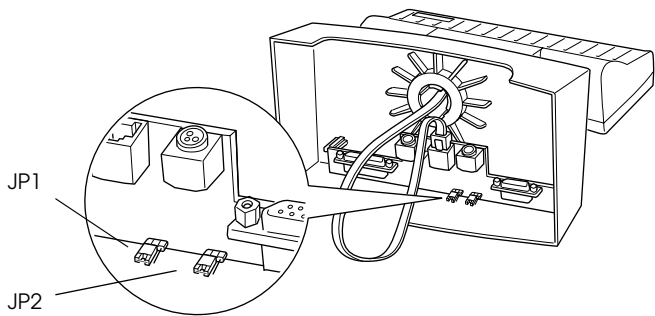



Precautions on using the power supply unit

To avoid damage to the DM-D110 and the power supply unit, make sure to note the following points.

- ❑ Use the optional Seiko Epson products, PS-170,PS-180, or PA-6508, PA-6511, PA-6513, PB-6509 or PB-6510 as the power supply.
- ❑ Never connect the DC cable to the power supply unit when the power supply unit is connected.
- ❑ Unplug the DC cable by holding the connector part. If you pull the cable to unplug it, it may be damaged.


Assembling steps

1. Pass the cable for the DM-D110 through the DM-D stand.
When extending the length of the DM-D stand, attach the extension support (DP-105) to the DM-D stand.

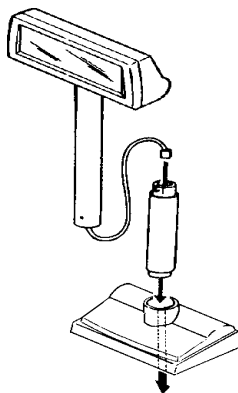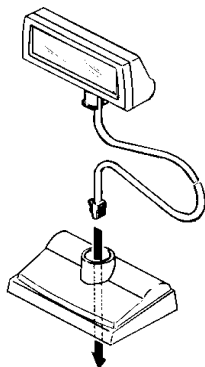


When using the
extension support
(DP-105)


2. Insert the tab on the DM-D110 (or the extension support) into the hole on the DM-D stand until you feel it click.

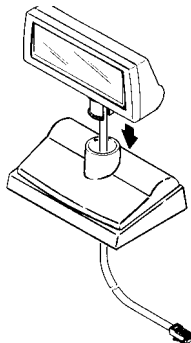


3. Connect the cable for the DM-D110 to the display connector on the DM-D stand until you feel it click.

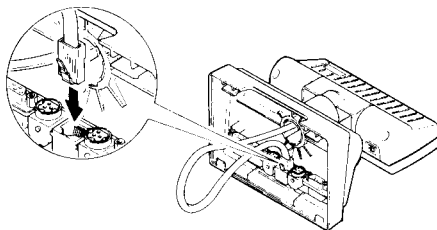


4. Connect one end of the computer interface cable to the computer connector on the DM-D stand; then connect the other end to the RS-232 connector on the computer. Tighten the screws on both ends of the cables to fasten them.

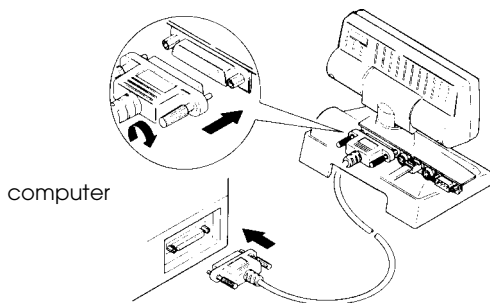


5. When using as a standalone, go to step 6.
When using with a printer, connect one end of the printer interface cable for the printer to the printer connector on the DM-D stand; then connect the other end to the connector on the printer. Tighten the screws on both ends of the cable to fasten them.

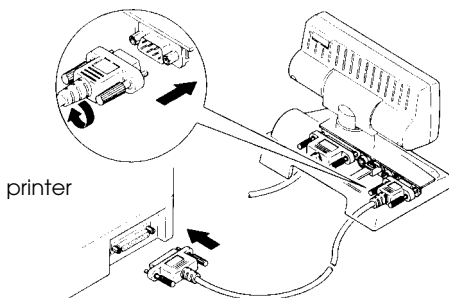


6. When not using the extension cable for power supply packed with the DM-D stand, go to step 7.
When using the extension cable, connect it (with the arrow mark up) to the extension cable connector indicated with "POWER OUT" on the DM-D stand; then connect the other end to the power connector on the printer.

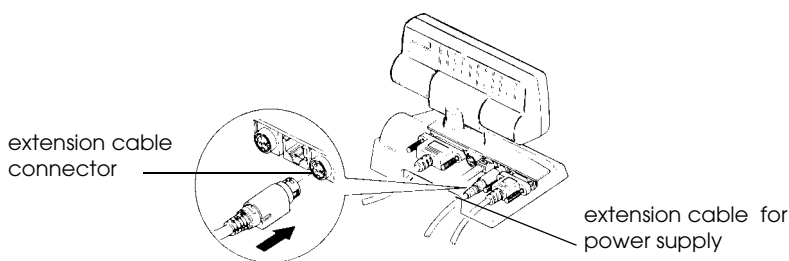


7. Connect the DC cable of the power supply unit (with the arrow mark up) to the power supply unit connector indicated with "POWER IN" on the DM-D stand.

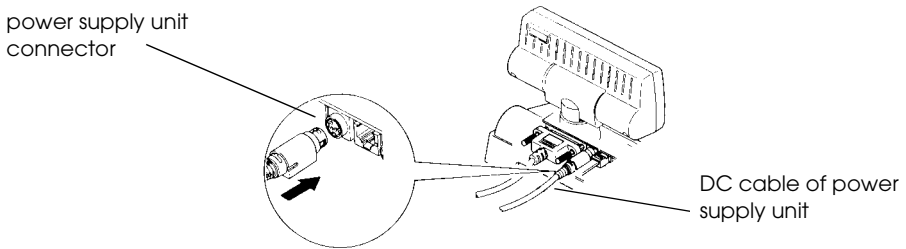

8. When using as a stand alone product, set the jumpers. (See "Jumper setting" on page 26.)
9. Arrange the cables as shown below. Put the cables for the DM-D110 inside the DM-D stand.

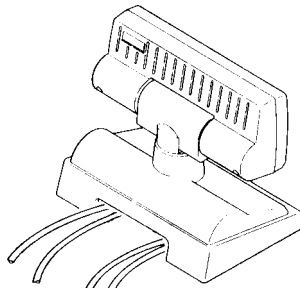


10. Attach the base plate to the DM-D stand following the number of the arrow shown below. At this time, push the base plate until it is locked by the hook on the DM-D stand.

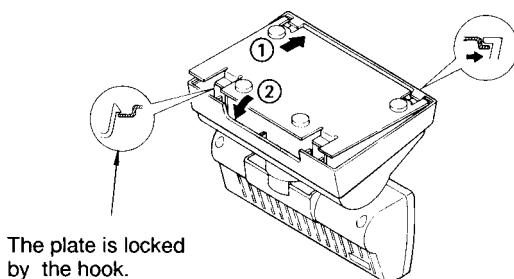

11. When the extension support (DP-105) is used, attach Velcro tapes to the four corners of the plate to keep the unit from falling down.
12. Connect the cord of the power unit to the socket.

Part Names and Functions

Exterior

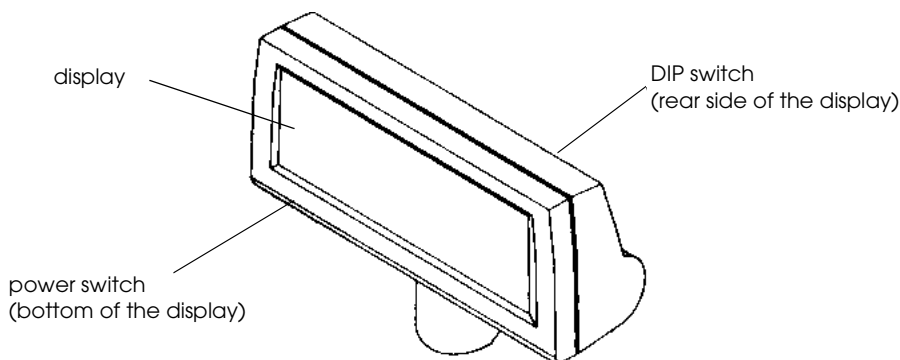

- ☐ Display: Characters are displayed.
- ☐ Power switch: The power is turned on/off.
- ☐ DIP switch: The functions of the DM-D110 are changed.
(See “DIP switch” for details.)



Note:

When turning on the DM-D110 again after turning it off, wait for at least 3 seconds.

DIP Switch

DIP Switch Functions

The DM-D110 has one DIP switch. The functions of the DIP switch are as follows:

DIP switch 1

DSW1 No.	Function	ON	OFF	Default setting
1-1	Data receive error	Ignored	Displays “?”	OFF
1-2	Data length	7 bits	8 bits	OFF
1-3	Parity on or off	Parity	No parity	OFF
1-4	Parity type	Even	Odd	OFF
1-5	Change transmission speed	See “Transmission speed.”		ON
1-6				OFF
1-7				ON
1-8	Self test selection (*)	Perform self test	Do not perform	OFF

(*)This function can select whether or not the self test is performed when you turn on the power. See “Self Test” for details.

Transmission speed


SW1-5	SW1-6	SW1-7	Transmission speed (bps)
ON	ON	ON	2400
OFF	ON	ON	4800
ON	OFF	ON	9600
OFF	OFF	ON	19200
ON	ON	OFF	38400
OFF	ON	OFF	57600
ON	OFF	OFF	115200
OFF	OFF	OFF	reserved

Setting the DIP switches

CAUTION:

Turn off the DM-D110 while removing the DIP switch cover to prevent electrical damage to the DM-D110.

1. Turn off the power for the DM-D110.
2. Remove the DIP switch cover.

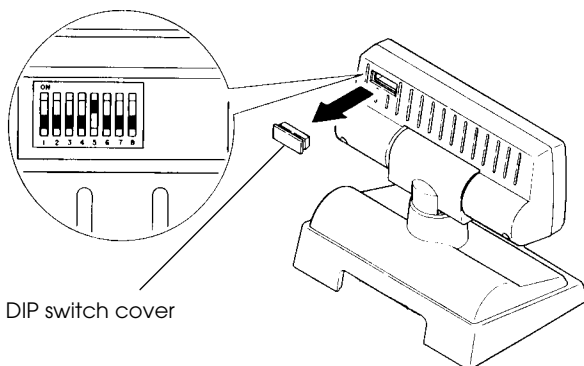


3. Change each setting of the switches with a pointed object, such as a pen tip or small screwdriver.
4. Close the cover and turn the power on.

Turning and Tilting the DM-D110

You can turn or tilt the display while holding the support. The display can be moved easily, so do not move any further if it stops. If you move it by force, you may damage it.

With the “DM-D pole unit for IR” (DP-504) and the “DM-D pole unit for TM printers (Type B)” (DP-503), the display area may not face the direction you desire. In this case, remove the base, change the position of the tab of the base so that the display faces to the direction you desire, and reattach it to the base.

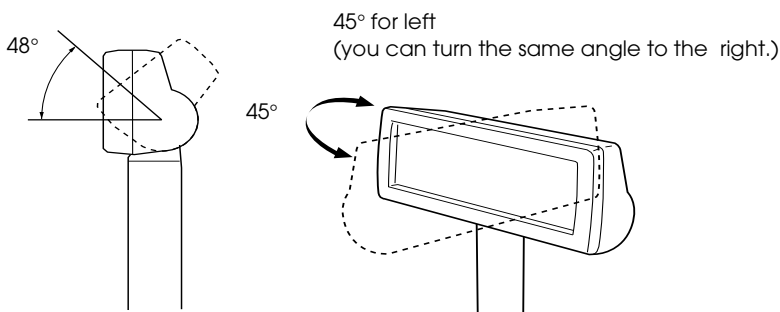

The display area has the following range of movement:

- ❑ Tilt: 48° max. (4 steps, 5 positions)
- ❑ Horizontal rotation: 90° max. (45° each, left and right)

Self Test

The DM-D110 has a self test function. If you want to perform a self test, you must change the setting of the DIP switch.

Check Items of Self test

The following items are checked during the self test:

- ☐ Control ROM version
- ☐ DIP switch settings
- ☐ Memory switch settings
- ☐ Example of display characters
- ☐ Example of each function, such as brightness, flashing, and scroll

Performing Self test

To perform the self test, follow the steps below.

1. Turn off the power for the DM-D110.
2. Set SW 1-8 of the DIP switch to ON, and turn on the power.



Note:

If the contents of the self test are not displayed, the DM-D110 may be malfunctioning. Please contact your DM-D110 dealer for assistance.

When the self test is finished and no error occurs, the DM-D110 is ready to receive data.

Diagnostics


The DM-D110 has a diagnostics function. When the DM-D110 is turned on, diagnostics, such as internal memory test, are carried out regardless of the DIP switch settings. When an error is detected, the error message is displayed and no operation is carried out until power is turned off.

Specification

General Specifications


- ❑ Height, Width, Depth and Weight

<DM-D110 and DM-D stand>

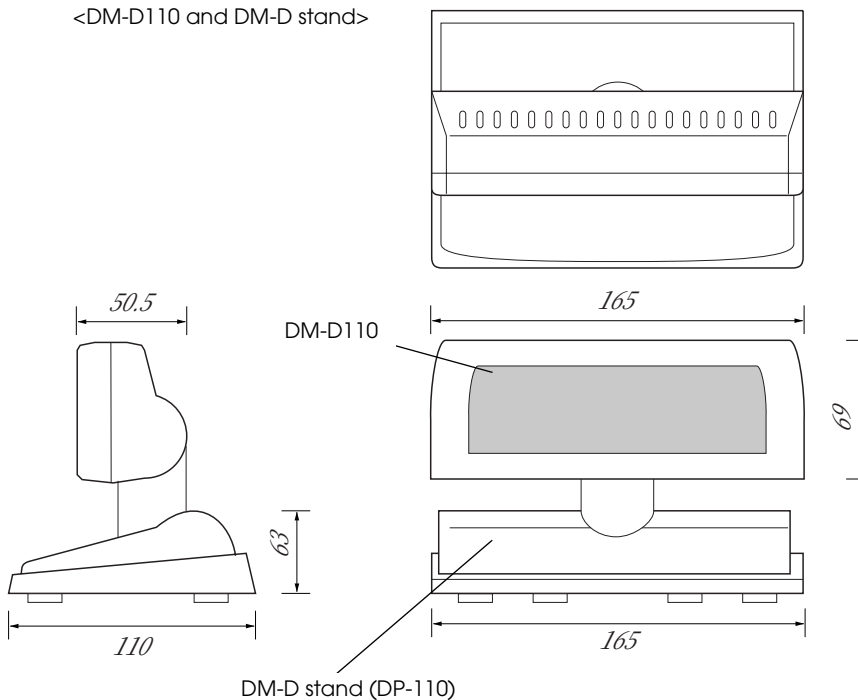

- DM-D110:
 Height: 69 mm
 Width: 165 mm
 Depth: 50.5 mm
 Weight: 285 g
- DM-D stand (DP-501):
 Height: 63 mm
 Width: 165 mm
 Depth: 110 mm
 Weight: 385 g

<DM-D pole units>

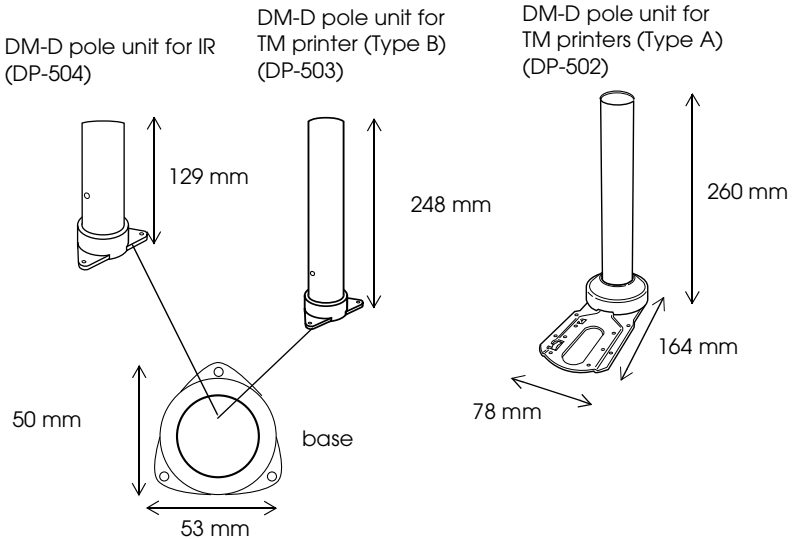

- Base and support A of the “DM-D pole unit for IR” (DP-504):

Height:	129 mm
Width:	50 mm
Depth:	53 mm
Weight:	60 g
- Base and support C of the “DM-D pole unit for TM printers (Type B)” (DP-503):

Height:	248 mm
Width:	50 mm
Depth:	53 mm
Weight:	116 g
- Fixing plate A and support C of the “DM-D pole unit for TM printers (Type A)” (DP-502):

Height:	260 mm
Width:	78 mm
Depth:	164 mm
Weight:	264 g

- ❑ Tilt angle Max 48° (4 steps, 5 positions)
- ❑ Horizontal rotation
 Max 90° (for each left and right at 45°)
- ❑ Vacuum fluorescent display
 - Number of characters: 20 column × 2 lines max.
 - Display color: Green (505 nm)
 - Brightness: 690 (cd/m²)

Electrical Specifications

- ❑ Type PS-170, PS-180, PA-6508, PB-6509, PB-6510,
 PA-6511, PA-6513 (when using the DM-D stand)
- ❑ Rated voltage DC 11.4 to 48 V
- ❑ Rated current 0.2 A (max.)

Environmental Specifications

- ❑ Operation environment
 - Temperature: 5°C to 40°C
 - Humidity: 30% to 85% (No condensation)
- ❑ Storage environment
 - Temperature: -10°C to 50°C
 - Humidity: 30% to 90% (No condensation)

Character Specifications

- ❑ Type of character
 - Alphanumeric characters: 95
 - International characters: 37
 - Extended graphics: 128 characters × 12 pages
- ❑ Character grid
 - Font : 5 × 7 dot, cursor
 - Character size 3.5 mm × 5.0 mm
 - Character pitch 5.2 mm

Reliability Specification

- ❑ MTBF (vacuum fluorescent display only)
 - 20,000 hours
 - (When the brightness is reduced to half)